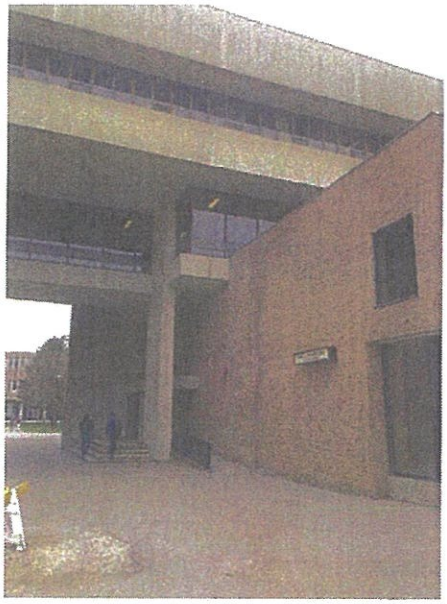


CPH

Asbestos Reassessment Report

Carl A Pollock Hall (Building No. 29)
200 University Avenue West, Waterloo, Ontario

Prepared for:

University of Waterloo
200 University Ave W.
Waterloo, Ontario, N2l 3Gl

Attention: Robert Mullins
Safety Officer

February 8, 2021


Pinchin File: 221052.000

© 2021 Pinchin Ltd.

completed

ABATEMENT ITEM #01 2021- 01


Location #:	Room 1330 Electrical Room		
Inspection Date:	01/19/21		
Material	2'x4" acoustic ceiling tiles		
Condition	Poor		
Accessibility	B		
Action Level:	3		
Type of ACM Operation:	Type 1 Removal		
Recommended Operation:		**Action**	**Quantity**
	X	Removal	8 SF ✓
		Repair	
		Encapsulation	
		Debris Clean-up	
Notes:	Observed 3 asbestos-containing acoustic ceiling tiles with visible water damage.		

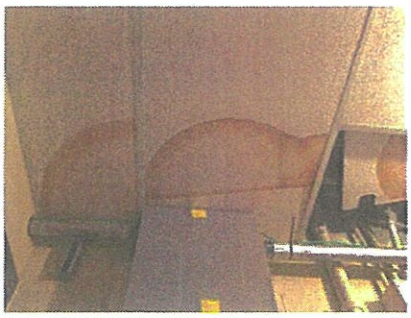

completed

ABATEMENT ITEM #02 2021- 01

Location #:	Room 3983 Mechanical Room		
Inspection Date:	01/19/21		
Material	Sprayed fireproofing debris		
Condition	Poor		
Accessibility	B		
Action Level:	3		
Type of ACM Operation:	Type 2 Debris Clean up. Type 2 precautions required to enter room until debris clean-up completed.		
Recommended Operation:		**Action**	**Quantity**
		Removal	
		Repair	
		Encapsulation	
	X	Debris Clean-up	2 SF ✓
Notes:	Sprayed fireproofing debris present on top of mechanical equipment		

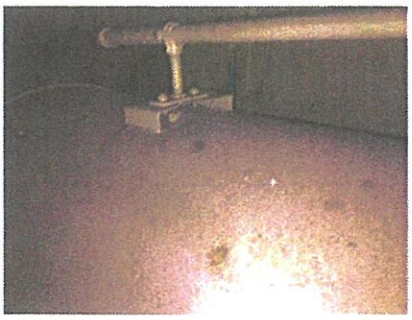


© 2021 Pinchin Ltd.

Not complete

ABATEMENT ITEM #03 2021- 01

Location #:	Throughout the Building		
Inspection Date:	01/19/21		
Material	Sprayed fireproofing debris		
Condition	Poor		
Accessibility	C (Visible)		
Action Level:	3		
Type of ACM Operation:	Type 2 Precautions to enter or work in ceiling space		
Recommended Operation:		**Action**	**Quantity**
		Removal	
		Repair	
		Encapsulation	
		Debris Clean-up	
Notes:	Sprayed fireproofing overspray and debris was observed on piping, conduit, on top of lay-in ceiling tiles, etc. in the ceiling spaces throughout majority of the building (refer to the database for all locations). Sprayed fireproofing debris was observed on top of ceiling tiles is various locations and is presumed to be present on-top of acoustic ceiling tiles throughout the building where sprayed fireproofing is present. O. Reg. 278/05 Type 2 procedures are required to enter or work within these ceiling spaces.		

Reason: Work to be T&M due to unknown quantities

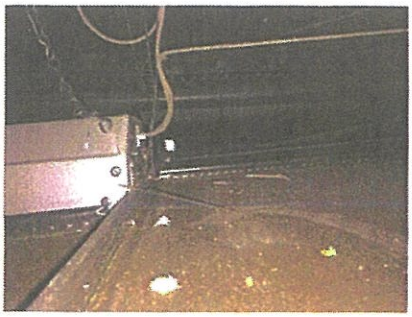

© 2021 Pinchin Ltd.